

SB, Stator change, DM400, DM430, 2020-06

AFFECTED UNITS

DM400 and DM430, from serial no: U8J202017400002.

SYMPTOM/DESCRIPTION

A new modern manufacturing system for the DM400 / DM430 Stator has been introduced. As a consequence we need to change the Screw that connects the electronics board with the stator (figure 3 and 4) in order to ensure proper EMC suppression. The Stator itself is backward compatible.

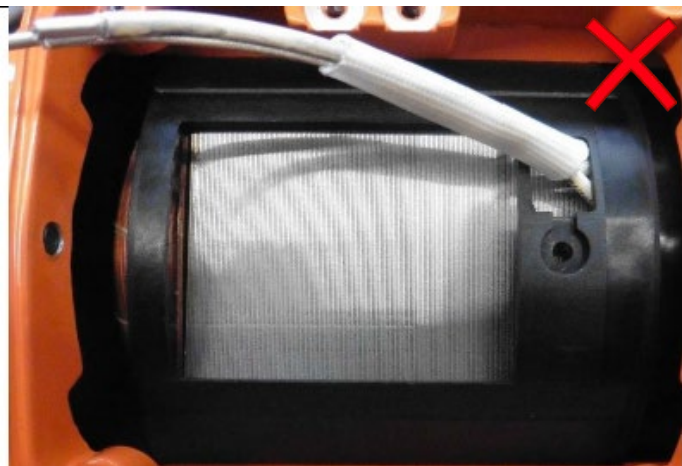


Figure 1: Old stator (current system)

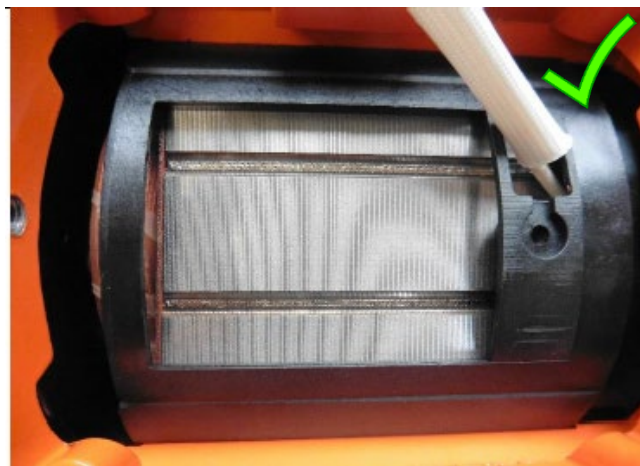


Figure 2: New stator (new system)



Figure 3: Actual Screw



Figure 4: Actual Screw, position on electronics board

PARTS INFORMATION

Part	Old article number	New article number
Screw	598809301	<i>NLA</i>
Screw	<i>New Part</i>	599980801
Stator 230V	598735901	598735903
Stator 120V	598735902	598735904

When a Stator is changed to the new type, the Screw 598809301 needs to be changed to 599980801 on the electronics board as well.

WARRANTY INFORMATION

The normal warranty policy applies.

Revision History

Rev.	Date	Order id.	Description
A	2020-06	SMB-5771	Created