SB, Starter cpl, K970, K970 II, K970 Ring, K970 II Ring, K970 Chain, K970 II Chain, K970 Rescue, K970 II Rescue, 2014-03

Affected models

K970, All models

Description

Starter cpl, 574 50 73-07 (pos. 1) does not include “COOLING AIR CONDUCTOR”, 544 28 75-02 (pos. 10) anymore.
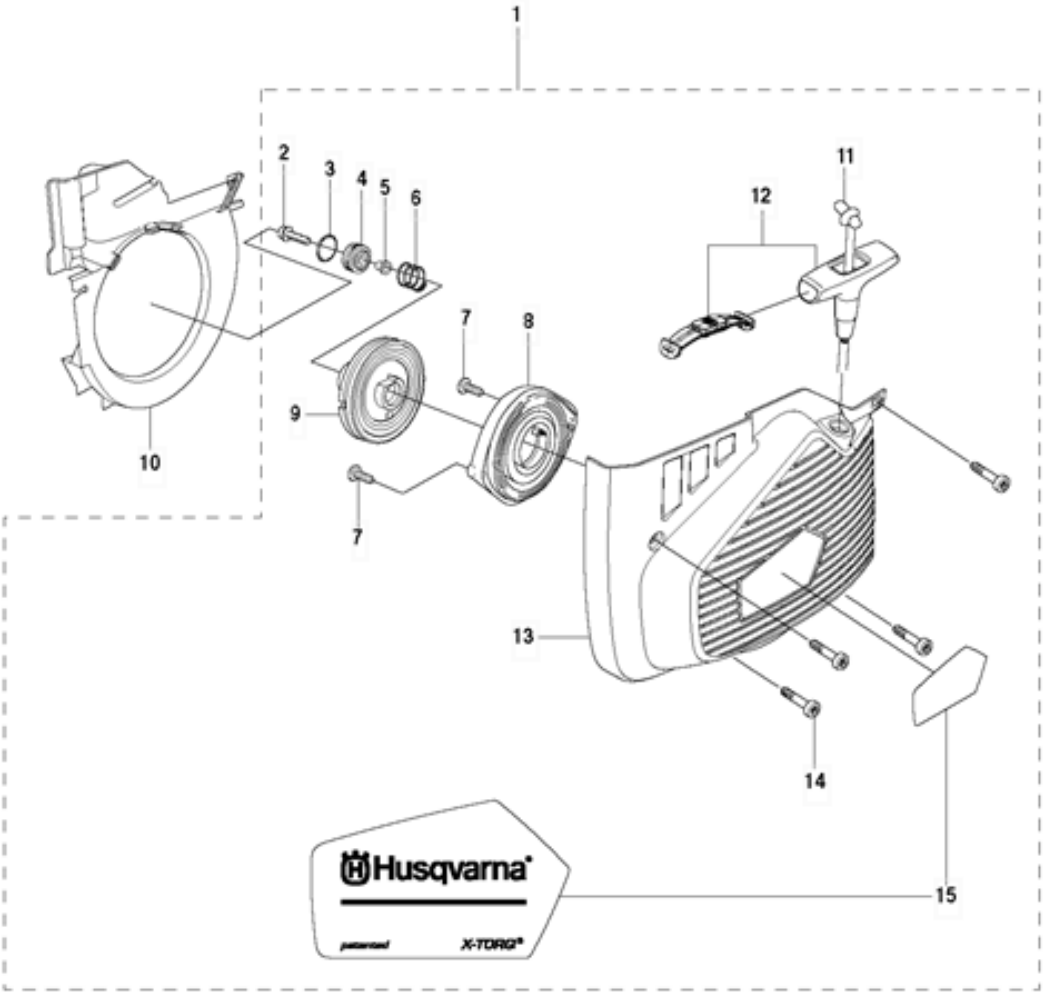
The Starter is compatible with earlier models of K970 by removing the skin for the decompression valve.