

## SB, Updated blade guard, FS305, FS309, 2017-04

### SYMPTOM/DESCRIPTION

The blade guard for FS 305 and FS 309 has been modified to get the same design on all markets and to achieve a more robust watering system.

Blade guard changes:

- Minor design changes to front, back and side cover parts.
- Water valve moved backwards.
- Hose material changed and hoses made longer.

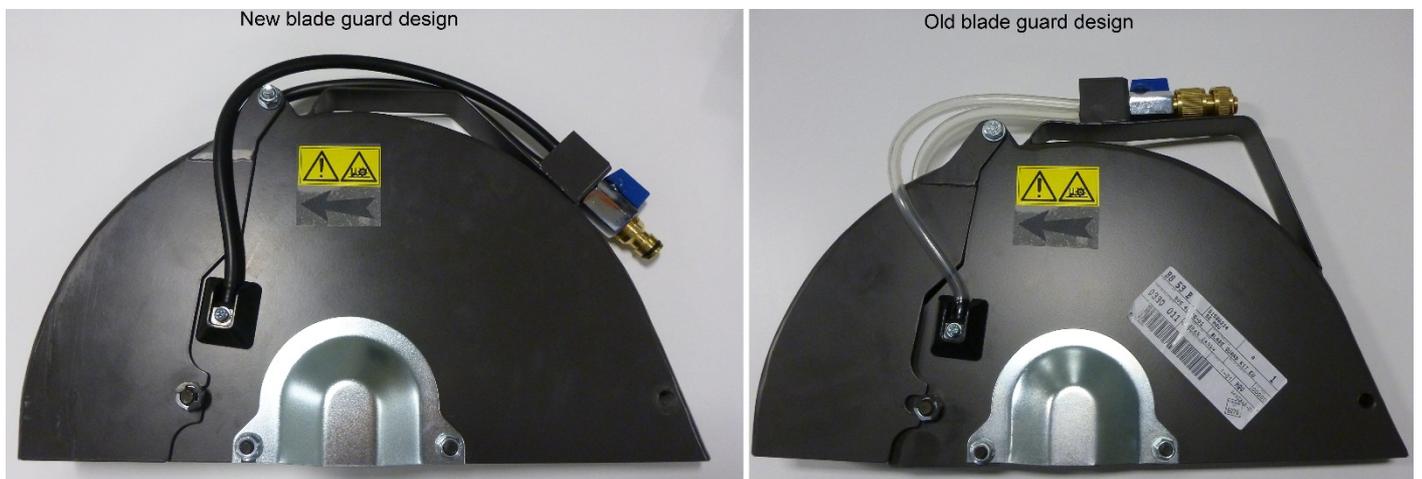


Figure 1: New blade guard design left, old design to the right.

### AFFECTED UNITS

The new blade guard design is implemented in production from serial number: **2016 4000018**.

### CORRECTIVE ACTION

When replacing blade guard parts - order spare parts according to the spare parts list published online.

## PARTS INFORMATION

Description	Pos. in figure 2	New part no.	Old part no.
Complete blade guard assembly	23	579 80 10-01	505 42 46-01 * (US version) 543 08 41-39 * (EU version)
Water hose	4 / 5	588 81 99-01	543 04 55-77 *
Front blade guard	2	579 80 12-01	505 41 54-01 * (US version) 501 97 65-01 ** (EU version)
Cover plate	3	579 80 24-01	543 08 23-17 *

Table 1: Spare part details new and old blade guard.

\* New and old parts are compatible. Use up old parts in stock and then supersede with the new part number.

\*\* The old front blade guard part EU version is not compatible with the new blade guard design and is therefore terminated. Order complete blade guard instead (579 80 10-01).

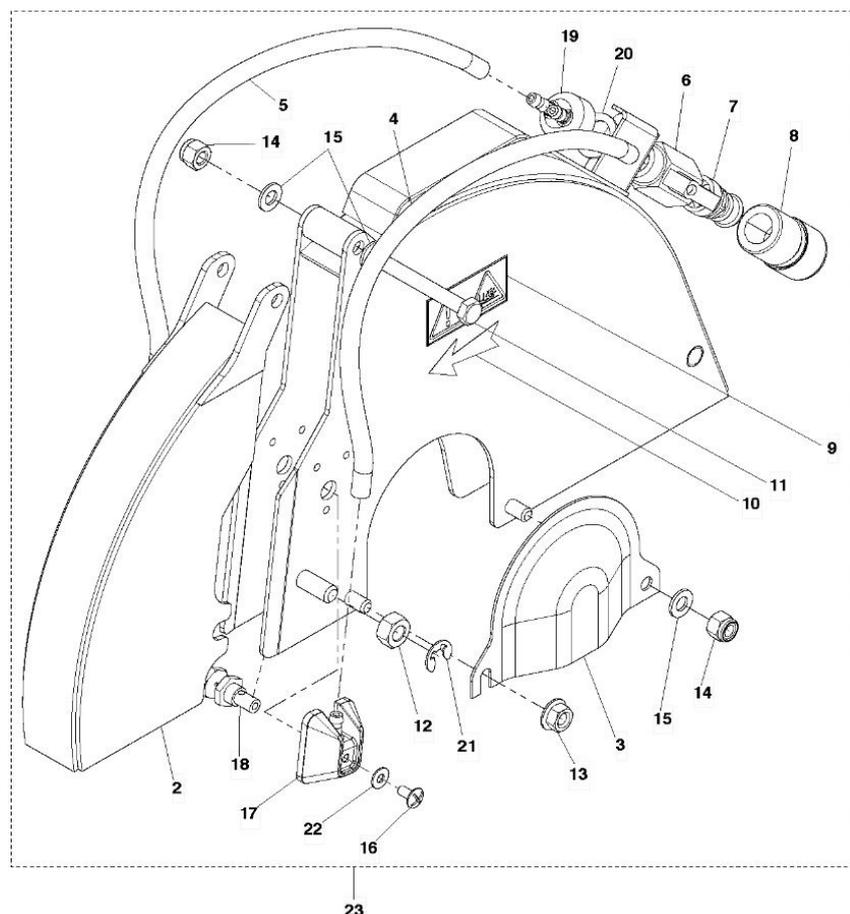


Figure 2: Illustration of new blade guard from spare parts list.

## WARRANTY INFORMATION

The normal warranty policy applies.