

SB, New Motor/Cutter Arm, K7000 Family, 2021-11

SYMPTOM/DESCRIPTION

Field reports has shown that the screws holding the cutter arm to the motor on K7000 family can come lose and damage the motor. In order to improve this we have implemented steering pins on the motor (figure 1) and corresponding holes on the cutter arm (figure 2) to hold the two pieces in a fixed position.

Since old parts are not mixable with new parts we have created a service kit which includes both motor and cutter arm for each variant.

AFFECTED UNITS

K7000 Family

K6500 Family – Only for spare parts

CORRECTIVE ACTION

- To upgrade to the new system or if a new motor is needed, please order the MOTOR KIT, see *Parts Information* table.
- Once the upgrade is done it is possible to order the CUTTER ARM separately, see *Parts Information* table.

The MOTOR KITS and CUTTER ARMS work on both the K6500 and K7000 family.

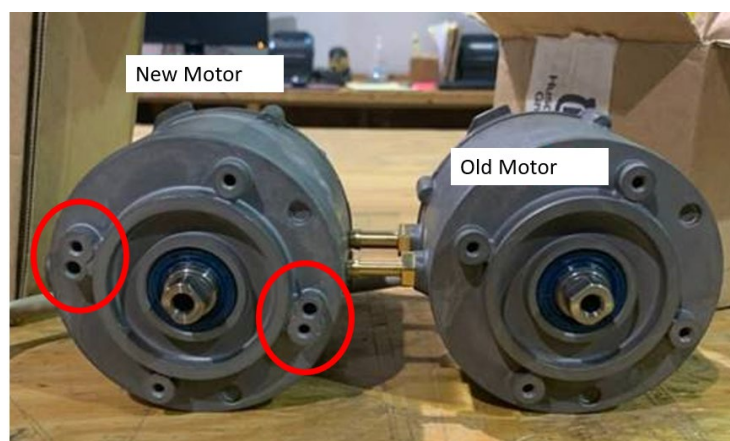


Figure 1: New Motor with steering pins.

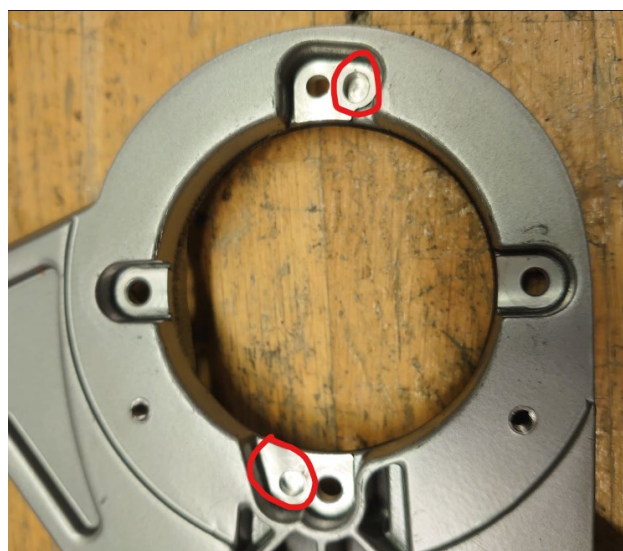


Figure 2: New Cutter arm with corresponding holes.

PARTS INFORMATION

Part Name	Old Part No.	New Part No.
CUTTER ARM – STANDARD	525339401	525339402
CUTTER ARM – RING	581125101	581125102
CUTTER ARM – CHAIN	588576201	588576203
MOTOR KIT K7000 STANDARD	New Kit	599637205
MOTOR KIT K7000 RING	New Kit	599637206
MOTOR KIT K7000 CHAIN	New Kit	599637207

WARRANTY INFORMATION

The normal warranty policy applies.

Revision History

Rev.	Date	Order id.	Description
A	2021-11	00015079	Created